



Campaign Code	Campaign Type	Production Time	Chassis Range	Concerned Component	Problem	Intervention Required
6236	RECALL	FROM SEPTEMBER 2010 TO JULY 2015	FROM 01039441 TO 0X039500	PASSENGER'S AIRBAG	BECAUSE OF AN INCORRECT PROXY FILE, THE PASSENGER AIRBAG CAN BE DEACTIVATED, WHEREBY FAILING TO COMPLY WITH THE REQUIREMENTS OF AUSTRALIAN LAW	THE PROXY FILE MUST BE UPDATED, AS ALREADY IMPLEMENTED IN PRODUCTION, SO THAT THE PASSENGER AIRBAG CANNOT BE DEACTIVATED
6144	RECALL	FROM OCTOBER 2016 TO JANUARY 2017	FROM ZAR9550000X052272 TO ZAR9550000X063287	FRONT SEAT BELT PRETENSIONER	POSSIBLE FRONT SEAT BELT NON-CONFORMITY	PRETENSIONER REPLACEMENT
6071	RECALL	FROM SEPTEMBER 2010 TO DECEMBER 2015	FROM ZAR95500001129937 TO ZAR95500001192150 AND FROM ZAR9550000X010576 TO ZAR9550000X047842	DRIVER'S AIR BAG MODULE	POSSIBLE NON-CONFORMITY OF SECOND STAGE FIRING CHARGE	DRIVER'S AIRBAG MODULE REPLACEMENT
6051	RECALL	FROM JUNE 2016 TO JULY 2016	FROM ZAR9550000X054539 TO ZAR9550000X056474	TYRES	TYRES NOT CONFORMING WITH TYPE-APPROVED VALUES SHOWN ON THE REGISTRATION CERTIFICATE (SPEED RATING "H" INSTEAD OF "V"), 195/55 R16 87H (INCORRECT) INSTEAD OF 195/55 R16 87V (CORRECT).	TYRE REPLACEMENT
5967	RECALL	SEPT 2015	FROM ZAR9550000X043362 TO ZAR9550000X043958	TYPE-APPROVAL DATA PLATE	THE NAME OF THE MANUFACTURER MAY BE INDICATED AS FGA (WRONG) INSTEAD OF ALFA ROMEO (CORRECT) ON THE TYPE-APPROVAL DATA PLATES AS A RESULT OF A PRINTING ERROR	TYPE-APPROVAL DATA PLATE REPLACEMENT
5798	RECALL	FROM MAY 2011 TO DECEMBER 2012	FROM ZAR95500001160729 TO ZAR95500001209073	REGISTRATION CERTIFICATE	DUE TO A WRONG FILLING-IN OF THE TECHNICAL DOCUMENTATION, THE VALUE FOR THE FUMES ON THE REGISTRATION CERTIFICATE MIGHT BE WRONG (0.50 INSTEAD OF 0.51); FURTHERMORE, THE EXTENSION TO INCLUDE 195/55 R16 87H, 215/45 R17 87W AND 215/40 R18 9W SIZE TYRES AS A	REGISTRATION CERTIFICATE UPDATE
5717	RECALL	FROM MAY 2011 TO NOVEMBER 2012	FROM ZAR95500001162360 TO ZAR95500001208382	REGISTRATION CERTIFICATE	ON VERSIONS WITH 1.4 MULTI AIR 105 HP ENGINE, DUE TO THE MISSED TYPE-APPROVAL EXTENSION TO 955AXL1B 08 AND 955AXL1B 08B VERSIONS, THE 185/65R15 88H TYRE INSTALLED ON THE CARS IS NOT SHOWN ON THE REGISTRATION CERTIFICATE.	REGISTRATION CERTIFICATE UPDATE
5706	RECALL	FROM MAY 2011 TO MAY 2012	FROM ZAR95500001161550 TO ZAR95500001198233	TYRES	TYRES FITTED ON THE CARS, HAVING SIZE 205/45 R17 88W (WRONG) NOT SUITABLE FOR THIS CAR TYPE, RATHER THAN SIZE 215/45 R17 87W (CORRECT)	TYRE REPLACEMENT
5679	RECALL	FROM JULY 2012 TO SEPTEMBER 2012	FROM ZAR95500001199555 TO ZAR95500001204529	BRAKE SERVO PIPING	POSSIBLE NON-COMPLIANCE OF THE CONNECTOR FOR THE BRAKE SERVO PIPING	BRAKE SERVO PIPING REPLACEMENT
5390	RECALL	FROM TYPE STARTING DATE TO JULY 2008	FROM TYPE PRODUCTION START TO ZAR95500001002410	DOCUMENTATION ABOUT THE MAX. TOWABLE WEIGHT	POSSIBLE WRONG DOCUMENTATION ON THE MAX. ALLOWED WEIGHT	UPGRADE OF THE SUMMARY DATA PLATE AND POSSIBLE UPGRADE OF THE REGISTRATION CERTIFICATE
6078	SERVICE	OCTOBER 2016	FROM ZAR9550000X055669 TO ZAR9550000X060372	TRANSMISSION C 514 - PLANETARY WASHER	POSSIBLE NON-CONFORMITY OF THE PLANETARY WASHER	CHECK AND REPLACE PLANETARY WASHER, IF NECESSARY
6066	SERVICE	FROM MAY 2014 TO OCTOBER 2016	FROM ZAR9550000X023623 TO ZAR9550000X059194	ENGINE CONTROL MODULE	POSSIBLE DIFFICULTY IN COLD ENGINE STARTING ON VERSIONS WITH 0.9 TWIN AIR EURO 6 ENGINES	ENGINE CONTROL MODULE SOFTWARE UPDATE
6061	SERVICE	FROM APRIL 2016 TO SEPTEMBER 2016	FROM ZAR9550000X050847 TO ZAR9550000X058237	ENGINE CONTROL MODULE	THIS IS NOT A PROBLEM.	ON VERSIONS WITH 1.3 MJET EURO 6 ENGINES, EURO 6 CALIBRATION UPDATE WITH NEW DATA SETS TO IMPROVE PERFORMANCE IN TERMS OF EMISSIONS IN REAL DRIVING CONDITIONS.



5972	SERVICE	FROM: JUNE 2015 TO DECEMBER 2015	FROM ZAR9550000X039343 TO ZAR9550000X047372	PARKING ACTUATOR CONTROL	ON VERSIONS WITH TCT, IT COULD BE DIFFICULT TO OPERATE THE GEAR LEVER	LUBRICATION OF THE PARKING ACTUATOR
5952	SERVICE	FROM JUNE 2013 TO JULY 2015	FROM ZAR9550000X003660 TO ZAR9550000X044027 AND SINGLE CHASSIS ZAR95500001212112	ENGINE CONTROL MODULE	ON VERSIONS WITH 1.3 Mjet EURO 5 PLUS ENGINE, POSSIBLE INCORRECT ALTERNATOR OPERATION	ENGINE CONTROL MODULE SOFTWARE UPDATE
5940	SERVICE	FROM MAY 2013 TO MAY 2015	FROM ZAR9550000X005325 TO ZAR9550000X040057	REGISTRATION CERTIFICATE	ON VERSIONS WITH 1.3 JTDM 85 HP EURO 5 ENGINE, SIZE 185/65 R15 88T TYRES WHICH CAN BE MOUNTED ALTERNATIVELY ON THE VEHICLE ARE NOT SHOWN ON THE REGISTRATION CERTIFICATE AS THE RESULT OF A DATA UPLOADING ERROR TO THE ITALIAN MINISTRY FOR INFRASTRUCTURE AND	REGISTRATION CERTIFICATE UPDATE
5866	SERVICE	FROM NOVEMBER 2013 TO SEPTEMBER 2014	FROM ZAR9550000X008113 TO ZAR9550000X030537 PLUS THE INDIVIDUAL CHASSIS ZAR95500001212112	GLOW PLUGS	ON VERSIONS WITH 1.3 MULTIJET ENGINE, POSSIBLE INCORRECT OPERATION OF THE GLOW PLUG SYSTEM	POWERTRAIN CONTROL MODULE SOFTWARE UPDATE
5829	SERVICE	FROM APRIL 2014 TO MAY 2014	ZAR9550000X024481	BRAKE SERVO VACUUM UNIT	POSSIBLE OIL LEAK FROM VACUUM UNIT ON VERSIONS WITH 1.6 AND 2.0 MULTIJET ENGINE	VACUUM UNIT REPLACEMENT
5826	SERVICE	FROM MARCH 2014 TO MAY 2014	FROM ZAR9550000X013036 TO ZAR9550000X025435 PLUS THE INDIVIDUAL CHASSIS ZAR95500001212112	BODY COMPUTER PROXY	ON THE VERSIONS WITH 1.3 JTDm 85 HP ENGINE, THE FUNCTION OF THE GEAR SHIFT INDICATOR MIGHT NOT HAVE BEEN ACTIVATED	BODY COMPUTER PROXY UPDATE
5825	SERVICE	FROM MARCH 2014 TO APRIL 2014	FROM ZAR9550000X017221 TO ZAR9550000X022278	ENGINE PRE-WIRING CONNECTIONS	ON VERSIONS WITH 1.4 PETROL MULTIair 140 AND 170 HP ENGINE, POSSIBLE NON-COMPLIANCE OF THE ENGINE PRE-WIRING, WITH FOLLOWING ENGINE MALFUNCTION (LOOSE CONTACTS)	ENGINE PRE-WIRING CONNECTOR REPLACEMENT
5792	SERVICE	DECEMBER 2013	FROM ZAR9550000X013309 TO ZAR9550000X016010	POWERTRAIN CONTROL MODULE 1.4 PETROL	ON VERSIONS WITH 1.4 8V EURO 6 PETROL ENGINE, IRREGULAR SWITCHING-ON OF THE ENGINE FAILURE WARNING LIGHT MIGHT OCCUR	REPLACEMENT OF THE POWERTRAIN CONTROL MODULE
5789	SERVICE	FROM JUNE 2011 TO DECEMBER 2013	FROM ZAR9550000X000003 TO ZAR9550000X016100 AND FROM ZAR95500001142932 TO ZAR95500001213240	INJECTION PRESSURE SENSOR	ON VERSIONS WITH 1.4 PETROL AND LPG ENGINE, POSSIBLE SPONTANEOUS SWITCHING FROM LPG TO PETROL FUEL SUPPLY MODE, WITH RESULTING SWITCHING-ON OF THE INJECTION FAILURE WARNING LIGHT ON THE INSTRUMENT PANEL.	EPLACEMENT OF PRESSURE SENSOR ON LPG INJECTOR UNIT
5771	SERVICE	FROM JUNE 2013 TO JULY 2013	FROM ZAR9550000X000964 TO ZAR9550000X010007	VP2 RADIO/RADIONAVIGATOR SOFTWARE	DUE TO A SOFTWARE NON-COMPLIANCE, THE RADIONAVIGATOR COULD NOT BE WORKING PROPERLY	RADIO/RADIONAVIGATOR SOFTWARE UPDATE
5754	SERVICE	FROM JUNE 2011 TO MAY 2013	FROM ZAR95500001168648 TO ZAR95500001213237 FROM ZAR9550000X000001 TO ZAR9550000X006919	REGISTRATION CERTIFICATE	DUE TO A FAILURE TO UPDATE DATA IN THE MINISTRY'S COMPUTER PROCESSING SYSTEM, THE REGISTRATION CERTIFICATE DOES NOT INDICATE THE EXTENSION TO INCLUDE ALTERNATIVE 185/65 R15 88T OR 185/65 R15 88H SIZE TYRES.	REGISTRATION CERTIFICATE UPDATE
5745	SERVICE	JUNE 2013	FROM ZAR9550000X003661 TO ZAR9550000X007210	RADIO SOFTWARE	ON VERSIONS WITH VP2 RADIO FOR THE FRENCH MARKET, POSSIBLE NON COMPLIANCE OF THE RADIO SOFTWARE	RADIO SOFTWARE UPDATE
5722	SERVICE	FROM DECEMBER 2012 TO APRIL 2013	FROM ZAR95500001208978 TO ZAR95500001213235 AND FROM ZAR9550000X000593 TO ZAR9550000X001318	UPPER CYLINDER HEAD COVER SCREWS	ON VERSIONS WITH 1.4 TJet AND 1.4 Fire Petrol engines: POSSIBLE NON-COMPLIANT TIGHTENING	CHECK AND POSSIBLE TIGHTENING OF THE SCREWS TO THE PRESCRIBED TORQUE.
5695	SERVICE	FROM APRIL 2012 TO JULY 2012	FROM ZAR95500001187919 TO ZAR95500001202230	ENGINE COOLING	POSSIBLE NON-COMPLIANCE OF THE ENGINE THERMOSTAT	CHECK AND REPLACE THERMOSTAT IF NECESSARY
5691	SERVICE	FROM JULY 2012 TO OCTOBER 2012	FROM ZAR95500001201099 TO ZAR95500001207832	GEARBOX CONTROL ACTUATOR	ON MiTo VERSIONS WITH 1.4 PETROL ENGINES, HAVING A TCT, OIL LEAKS MIGHT OCCUR FROM THE GEARBOX CONTROL ACTUATOR.	Odd gear clutch release control actuator - CSC



5684	SERVICE	FROM SEPTEMBER 2011 TO SEPTEMBER 2012	FROM ZAR95500001170705 TO ZAR95500001206392	IGNITION COILS	ON VERSIONS WITH TWINAIR POWER UNIT, DUE TO A POSSIBLE NON-COMPLIANCE OF THE IGNITION COILS, SOME ENGINE MISFIRING MIGHT OCCUR	ENGINE IGNITION COIL REPLACEMENT
5655	SERVICE	FROM MARCH 2012 TO APRIL 2012	FROM ZAR95500001178978 TO ZAR95500001195972	BODY COMPUTER	THE "CONVERGENCE" MIGHT NOT WORK ON THE VERSIONS HAVING THE MATRIX INSTRUMENT PANEL, DUE TO A WRONG ALIGNMENT OF THE BODY COMPUTER PROXY	BODY COMPUTER PROXY UPDATE
5629	SERVICE	FROM SEPTEMBER 2010 TO MARCH 2011	FROM ZAR95500001051338 TO ZAR95500001152871	AUTOMATIC TRANSMISSION	ON VERSION 1.4 TURBO PETROL 16V 135 HP MULTIAR WITH TCT, POSSIBLE OPERATING FAULTS OF HILL HOLDER AND START&STOP. AT THE SAME TIME, THE PLUG FOR THE CLUTCH RELEASE ACTUATOR MUST BE REPLACED TO PREVENT POSSIBLE OIL LEAKS FROM THE SAME ACTUATOR	AUTOMATIC TRANSMISSION CONTROL UNIT SOFTWARE UPDATE. CLUTCH RELEASE ACTUATOR PLUG REPLACEMENT
5620	SERVICE	FROM OCTOBER 2011 TO NOVEMBER 2011	ZAR95500001180205 TO ZAR95500001181340	TCT TRANSMISSION	ON VERSIONS WITH TCT, DUE TO A FAILED LEARNING OF CLUTCH TRANSMISSIBILITY PARAMETERS AT THE END OF THE PRODUCTION LINE, A NOISE (KNOCK) DURING GEAR SHIFTING MIGHT OCCUR, ESPECIALLY WHILE SHIFTING FROM FIRST TO SECOND GEAR	PERFORMANCE OF THE CORRECT LEARNING PROCEDURE
5611	SERVICE	FROM OCTOBER 2011 TO NOVEMBER 2011	FROM ZAR95500001174716 TO ZAR95500001183214	ENGINE	ON 1.4 PETROL 16V VERSION, DUE TO A POWER UNIT PISTON MACHINING NON-COMPLIANCE, AN EXCESSIVE OIL CONSUMPTION AND/OR A SEIZURE OF THE POWER UNIT MIGHT OCCUR OVER TIME.	ENGINE REPLACEMENT
5499	SERVICE	FROM MAY 2010 TO SEPTEMBER 2010	FROM ZAR95500001112942 TO ZAR95500001133772	TCT TRANSMISSION	ON 1.4 135 HP VERSION WITH TCT TRANSMISSION, POSSIBLE INCORRECT COUPLING BETWEEN ENGINE AND AUTOMATIC TRANSMISSION	AUTOMATIC TRANSMISSION REPLACEMENT
5497	SERVICE	FROM DECEMBER 2008 TO OCTOBER 2010	FROM CHASSIS ZAR95500001024689 TO CHASSIS ZAR95500001136062	TAPPET COVER	ON 1.4 105 HP MULTIAR ENGINE, POSSIBLE IRREGULAR ENGINE OIL CONSUMPTION	CHECK AND POSSIBLE INTERVENTION ON TAPPET COVER TO IMPROVE INTERNAL OIL DRAINAGE
5493	SERVICE	FROM AUGUST 2009 TO SEPTEMBER 2010	FROM ZAR95500001054466 TO ZAR95500001129578	FRONT HEADLIGHTS	ON QUADRIFOGLIO VERDE MODELS WITH 1.4 170 HP ENGINE, POSSIBLE AESTHETICAL STRAINS ON THE INSIDE FRAME OF THE FRONT HEADLIGHTS AFTER A LONG EXPOSURE TO SUN LIGHTS	FRONT HEADLIGHT REPLACEMENT
5455	SERVICE	FROM APRIL 2009 TO APRIL 2010	FROM CHASSIS ZAR95500001039955 TO CHASSIS ZAR95500001107665	DRIVESHAFTS	ON 1.4 170 HP ENGINE, POSSIBLE NON-COMPLIANT TIGHTENING OF THE METAL BAND FOR DRIVESHAFT BOOT SEALING	CHECK AND POSSIBLE RESTORATION OF THE CORRECT TIGHTENING
5376	SERVICE	FROM TYPE STARTING DATE TO MARCH 2009	FROM TYPE PRODUCTION STARTING DATE TO ZAR95500001036089 AND SINGLE CHASSIS ZAR95500001045216	OWNER HANDBOOK	DUE TO A MISPRINT, THE MAX. WEIGHT THAT CAN BE CARRIED ON THE CAR ROOF IS 40 KG INSTEAD OF 75 KG (MISPRINT).	OWNER HANDBOOK UPDATE
5374	SERVICE	FROM START OF TYPE TO FEBRUARY 2009	FROM START OF TYPE TO ZAR95500001029317	FRONT BRAKES	POSSIBLE NOISE/SCREECHING WHILE BRAKING	ADOPTION OF NOISE DEADENING PLATES ON FRONT BRAKE SHOES
5373	SERVICE	FROM START OF TYPE TO FEBRUARY 2009	FROM START OF TYPE TO ZAR95500001031029	ENGINE COMPARTMENT LAYOUT	ON VERSION 1.6 JTDm, POSSIBLE INCORRECT POSITIONING OF THE POSITIVE BATTERY WIRE INSIDE THE SPECIFIC CLIP	CHECK AND REPOSITION WIRE IN CLIP
5356	SERVICE	FROM START OF TYPE TO DECEMBER 2008	FROM START OF TYPE TO ZAR95500001023952	ENGINE MANAGEMENT CONTROL UNIT SOFTWARE	POSSIBLE IRREGULAR CURRENT ABSORPTION	ENGINE MANAGEMENT CONTROL UNIT SOFTWARE UPDATE



5346	SERVICE	FROM START OF TYPE TO OCTOBER 2008	FROM START OF TYPE TO ZAR95500001018624	ENGINE COMPARTMENT LAYOUT	ON THE 1.6 MJET VERSION, THERE MAY BE INTERFERENCE BETWEEN THE INJECTION LEAD AND THE METAL BRACKET	ADOPTION OF LEAD GUIDE, SPACER AND MODIFICATION OF INJECTION CONTROL UNIT MOUNTING BRACKET
5339	SERVICE	FROM MARCH 2008 TO JUNE 2008	FROM ZAR95500001000069 TO ZAR95500001000645	FRONT AIRBAG MODULES	POSSIBLE NON CONFORMITY	REPLACE FRONT AIRBAG MODULES
5320	SERVICE	FROM 28/07/2008 TO 28/08/2008 (18 VEHICLES)	FROM ZRA955000*01002217 TO ZRA955000*01003882	UNDER-ENGINE SOUND INSULATION SHIELD	NON-COMPLIANCE	REPLACE THE UNDER-ENGINE SOUND INSULATION SHIELD
5319	SERVICE	FROM 01.07.08 TO 04.08.08	FROM ZRA955000*01000406 TO ZRA955000*01004629	FRONT NUMBER PLATE HOLDER	NON-COMPLIANCE	ADOPT SPECIAL NUMBER PLATE HOLDER
5318	SERVICE	FROM 07.07.08 TO 30.07.08	FROM ZRA955000*01000937 TO ZRA955000*01002397	BLU&ME NAV™ (C3) OPT 55Y SYSTEM	MALFUNCTION OF THE BLUE& ME NAV SYSTEM SOS FUNCTION	REPROGRAM THE BLU&ME NAV SYSTEM CONTROLLER
5308	SERVICE	JULY 2008	FROM ZAR95500001000487 TO ZAR95500001002993	DNA DEVICE	MANAGEMENT SOFTWARE OF DNA DEVICE, NOT OPTIMAL	SOFTWARE UPDATE
5305	SERVICE	FROM 06.02.08 TO 02.08.08	FROM ZRA955000*01000001 TO ZRA955000*01002237	INSTRUMENT PANEL	NON-COMPLIANCE OF INSTRUMENT PANEL	REPLACE THE INSTRUMENT PANEL
5304	SERVICE	FROM 06/03/2008 TO 04/07/2008	FROM ZRA955000*01000069 TO ZRA955000*01001941	FUEL TANK	NON-COMPLIANCE OF FUEL TANK	CHECK AND/OR REPLACE THE FUEL TANK